OREGON CORNER RESTORATION FORM

PREVIOUS RENEWALS/SURVEYS ETC.

Originally surveyed by Thompson under Contract #83 in 1859. He set post and made mound.

MONUMENTS AND ACCESSORIES FOUND: CONDITON AND SOURCE

Found Fence corner.

MONUMENT DETAIL

T2N R29E 20| 21 29| 28 2008 LS 951

OREGON STATE PLANE COORDINATES NORTH ZONE, NAD 83(91), Int Feet:

718940.83 8533315.33

MONUMENT SET (PROCEDURES AND DESCRIPTION)

At a fence corner I set a 2 3/8" brass cap on a 1" x 30" iron pipe at ground level stamped as above.

NEW ACCESSORIES FROM WHICH

A 5/8" x 30" Iron Rebar with plastic cap #951 bears N 0° 37' 06" W 92.14' A 5/8" x 30" Iron Rebar with plastic cap #951 bears N 88° 53' 29" E 59.60' A 5/8" x 30" Iron Rebar with plastic cap #951 bears S 1° 22' 00" E 49.27' A 5/8" x 30" Iron Rebar with plastic cap #951 bears N 89° 50' 34" W 21.65' These bearings and distances are State Plane.

LOCATION AND COMMENTS

From the intersection of Vey Road with Whitehouse Road go south along Whitehouse Road 2 1/2 miles to the end of graveled road. Go East on dirt road 1 mile to fence corner. Go SE on dirt road 1.2 miles to fork. Take right fork Southerly 0.4 mile to fence line. Go west along fence line .1 mile to corner.

SURVEYOR'S SEAL

FIRM: EDWARDS SURVEYING LLC PO BOX 763 - HERMISTON OR 97838

PARTY CHIEF: G. EDWARDS WITNESS: R. SMITH

OREGON
JULY 16, 1971
G. DENNIS EDWARDS
951

RENEWS 12/31/11

REGISTERED

PROFESSIONAL LAND SURVEYOR

C:\Works\N5R29-J1