

## CERTIFIED RECORD OF LAND CORNER MONUMENTATION


N-7 1-9

## History of original corner establishment:

Corner originally established by Rufus S. Moore, U.S. Deputy Surveyor, under GLO Contract No. 451, dated June 12, 1882. A wooden stake set a post 4' long, 4" square, 2 1/2" thick, laid for corner no Sec. 18. Surveyor General records state: A 6' 6" ins. in H.S. Set a post E 38 ft 7' long 3 ins. sq. 24 ins. in ground for 1/4 Sec. Cor marked 1/4S on W face from which: E edges from which: A fir 12" ins. in dia. bears N 12° W, 18 lks dist. marked 1/4S BT.

A tamarack 10 ins. in dia. bears S 28° E, 10 lks dist marked 1/4S BT. A fir 9" dia. bears S 62 W, 67 lks dist. marked T 5 S R 34 E S 20 BT.

A pine 11" dia. bears S 16 E, 138 lks dist. marked T 5 S R 34 E S 21 BT.

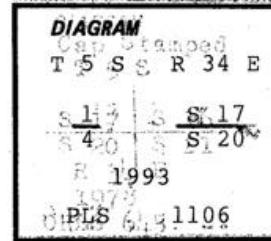

## (Description of corner evidence found:

No trace of corner post or bearing trees recovered. A assumed corner location marked by a wood post as described this corner was previously searched on 8-28-84 by at the corner location of Dave Dahlstrom, U.S.F.S. staff, and his search record states the area had been burned 180 to 100 years ago the face being He found no trace of corner or accessories, he is alive and in good This corner was searched for a total of 5 hours on 3 separate occasions with a 2 person crew. 2 hours of professional land surveyor time was spent. A searched and lying on radius of 150 feet was covered over. The corner area burnt many years ago and has been clearcut. No evidence of the remaining 2 bearing trees in Sects. 17 & 20.

## (Description of monument and accessories I established to perpetuate the original location of this corner:

At position determined by single proportionate measurement between the recovered Northwest corner and the existing Northeast corner to Section 17. A 2 1/2" brass cap on a 30 mil. iron pipe, and being stamped as shown above, with a Set a 2 1/2" aluminum cap on 2 1/2" x 30" aluminum pipe, 26" in ground, surrounded with mound of earth only. Set steel fence post 4' West of corner & attached sign 54-9 & 54-2.


## New bearing trees established:

- A 16" diam. Western larch brs. N 3° W, 88.5' mdk 1/4S17 BT. T 5 S R 34 E S 17 BT.  
 A 12" diam. Western larch brs. N 76° E, 52.2' mdk 1/4S17 BT. T 5 S R 34 E S 20 BT.  
 A 13" diam. Western larch brs. South 31.6' mdk 1/4S20 BT. T 5 S R 34 E S 21 BT.  
 A 11 1/2" diam. Western larch brs. S 33 W, 32.4' mdk 1/4S20 BT.

New bearing trees have a brass washer stamped PLS 1106 nailed to face of blaze. Attached sign 54-3 & 54-9, painted face of blaze & a 6" red band around each bearing tree, certify the above corner

Compass declination 18° East. monument was re-established as herein

I hereby certify that the above corner was properly re-established to U.S.F.S. standards by me on October 27, 1993.

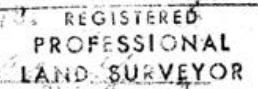

WILLIAM R. WELLS

OREGON

JULY 22, 1997

WILLIAM R. WELLS

1106

renews 12-31-94

Office of... County Surveyor..... County of... Umatilla.....

State of... Oregon..... I hereby certify that the within instrument was filed in this office

for record on the... day of... 19...

..... by ..... (DEPUTY)

(COUNTY OFFICIAL)

\*U.S. GOVERNMENT PRINTING OFFICE-1983-793-276

Form R6-7100-57 (9/71)  
Postage Paid

RECEIVED BY

Umatilla County Surveyor

Date 8-4-94

Rec'd By KK

No. 94-106-C