

# OREGON CORNER RESTORATION FORM

COUNTY: Umatilla DATE: 07/11/13

CORNER DESIGNATION: 3N32, A23, The North One-Quarter Corner of Section 1.

PREVIOUS RENEWALS/SURVEYS ETC.: Corner originally established by David Thompson, under GLO Contract 106, dated August 1864, notes state: Set post for 1/4 Sec. corner in mound of Earth with charred stake, pits, trench &c as per instructions.

MONUMENT AND ACCESSORIES FOUND: None.

MONUMENT MARKING DETAIL:

T4N R32E  
1 S36  
4 S1  
T3N  
2013  
PLS 54657

MONUMENT SET: Held mid-point between the Northwest and Northeast corners of Section 1 and the centerline of Midway Road for latitude. At the reestablished corner point, set a 2 3/8" brass cap on a 1 1/4" x 30" galvanized iron pipe, with cap 10 inches below ground level, stamped as stated in "Monument Marking Detail", from which:

A 5/8" x 24" iron rod with a 1 1/4" purple plastic cap marked "Wells Surveying, PLS 54657" in road bank, bears North 53° East, 26.6 feet.

A 5/8" x 24" iron rod with a 1 1/4" purple plastic cap marked "Wells Surveying, PLS 54657" in road bank, bears South 51° East, 25.8 feet.

A 5/8" x 24" iron rod with a 1 1/4" purple plastic cap marked "Wells Surveying, PLS 54657" in road bank, bears South 49 1/2° West, 25.0 feet.

A 5/8" x 24" iron rod with a 1 1/4" purple plastic cap marked "Wells Surveying, PLS 54657" in road bank, bears North 53° West, 27.5 feet.

Attached bearing object signs to all accessories.

LOCATION AND COMMENTS:

In centerline of Midway Road.

OREGON STATE PLANE COORDINATE, North Zone, NAD 83(91), International Feet:

N= 773856.03'

E= 8647131.30'


FIRM: Wells Surveying  
P.O. Box 1696  
Pendleton, OR 97801

COMPASS DECLINATION: 18° East

Surveyor's Seal

Witnesses: Jason Wells, PLS  
Dean Roy

\3N32A23

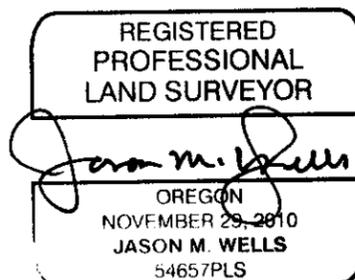

RENEWS: 6-30-14