
ERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:

Corner originally established by George S.Pershin, U.S. Deputy Surveyor, under Contract No. 390, dated May 12,1881. Surveyor General records state:

Set basalt stone 16 x 8 x 7 on S.E. face of bluff for 1/4 Sec.

A Pine 10 in.di.brs. N68°E, 24 lks.dist. A fir 14 in.di.brs. S76°W, 41 lks dist.

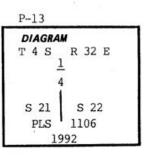

Description of corner evidence found:

Found a basalt stone 14 x 10 x 10" firmly set and marked 1/4 on West face in mound of stone.

A 21" douglas fir snag bears S81°W, 27.6' with scribing visible.

Description of monument and accessories I established to perpetuate the original location of this corner:

At position of original found stone ... Set a 2½" X 30" aluminum pipe with 2½" aluminum cap 18" in ground surrounded with mound of earth and stone. Set steel fence post next to corner and attached signs 54-2 & 54-9. Cap marked as shown in corner diagram. Set original stone alongside mound.

New bearing trees established: A 14" western larch brs S36 $3/4^{\circ}$ E, 37.8'dist mkd 1/4S22 BT. A 15" western larch brs S32 $\frac{1}{2}^{\circ}$ E, 42.2' dist mkd 1/4S22 BT. A 15" ponderosa pine brs N50 $\frac{1}{2}^{\circ}$ W, 32.4' dist mkd 1/4S21 BT. A 18" western larch brs S39 $3/4^{\circ}$ W, 127.4' dist mkd 1/4S21 BT.

New BT's have a brass washer stamped PLS 1106 nailed to face of blaze. Attached sign 54-3 & 54-9, painted face of blaze & a 6" red band around each BT.

Compass declination 180 East.

I hereby certify that the above corner monument was properly re-established to U.S.F.S. standards by me on June 09, 1992.

REGISTERED PROFESSIONAL LAND SURVEYOR CREGON JULY 22, 19/7 WILLIAM R. WELLS 1106

Office of County Surveyor	County of Umatilla	
	ertify that the within instrument was filed in this office	
for record on the day of		
by		P-13
(COUNTY OFFICIAL)	RECESVED BY	. /
Form R6-7100-57 (9/71)	Umatilla County Surveyor	☆ GPO—798-276
	Date	
	Rec'd By	
	No. 92-80-8	

CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:

Corner originally established by George S.Pershin, U.S. Deputy Surveyor, under Contract No. 390, dated May 12,1881. Surveyor General records state:

Set basalt stone 16 x 8 x 7 on S.E. face of bluff for 1/4 Sec. Cor.

A Pine 10 in.di.brs. N68°E, 24 lks.dist. A fir 14 in.di.brs. S76°W, 41 lks dist.

P-13 DIAGRAM T 4 S R 32 E S 21 S 22 PLS 1106 1992

Description of corner evidence found:

Found a basalt stone 14 x 10 x 10" firmly set and marked 1/4 on West face in mound of stone.

A 21" douglas fir snag bears S81°W, 27.6' with scribing visible.

Description of monument and accessories I established to perpetuate the original location of this corner:

At position of original found stone ... Set a $2\frac{1}{2}$ " X 30" aluminum pipe with $2\frac{1}{2}$ " aluminum cap 18" in ground surrounded with mound of earth and stone. Set steel fence post next to corner and attached signs 54-2 & 54-9. Cap marked as shown in corner diagram. Set original stone alongside mound.

New bearing trees established: A 14" western larch brs S36 $3/4^{\circ}$ E, 37.8'dist mkd 1/4S22 BT. A 15" western larch brs S32 $\frac{1}{2}$ E, 42.2' dist mkd 1/4S22 BT. A 15" ponderosa pine brs N50 $\frac{1}{2}$ W, 32.4' dist mkd 1/4S21 BT. A 18" western larch brs S39 3/4 W, 127.4' dist mkd 1/4S21 BT.

New BT's have a brass washer stamped PLS 1106 nailed to face of blaze. Attached sign 54-3 & 54-9, painted face of blaze & a 6" red band around each BT.

Compass declination 180 East.

Form

I hereby certify that the above corner monument was properly re-established to U.S.F.S. standards by me on June 09, 1992.

REGISTERED PROFESSIONAL LAND SURVEYOR Will- R. Wells CREGON JULY 22, 19/7 WILLIAM R. WELLS 1106

☆ GPO—798-276
P-13